

**GO-DEVIL® MANUFACTURERS OF
LOUISIANA, INC.**

18649 Womack Road * Baton Rouge, La 70817
(225) 752-0167 * Fax (225) 752-0175
www.godevil.com

SERVICE BULLETIN

25HP ICING UP

NO. 3

DATE: 03/26/97

RE: ALL 25 and 27 Horsepower Kohler Command Powered Go-Devils

PROBLEM: Engine bogs down at high speed in cold temperatures.

CONDITION FOUND: Carburetor venturi icing up.

SOLUTION: Install Kohler Anti-Icing Kit, Part Number 24 755 65. Current retail sales price is \$285.59, not including installation or freight.

We have found that this problem does not happen on all engines at any specified temperature. This is not a consistent problem. We believe that humidity plays a larger part in this problem than does temperature, because the ice is formed from humidity.