

# **SERVICE BULLETIN**

---

## **THROTTLES FREEZING**

**NO. 6**

**DATE: 04/03/97** (Updated 02/01/03)

**RE: ALL GO-DEVIL LONG TAIL MODELS**

**PROBLEM:** Throttle freezing up in cold temperatures.

**CONDITION FOUND:** Moisture in cable.

**SOLUTION:**

- Disconnect the throttle cable from the engine end.
- Remove the seal from the cable housing on the engine end.
- Un-snap the seal from the throttle end of the cable housing. Do NOT remove the seal from the cable. Do NOT disconnect the cable on the throttle end.
- Use Plastic bottle filled with WD40 and a 3/16" hose attached. Insert 3/16" hose over throttle wire and cable housing. Hold bottle vertically, upside down. Squeeze the bottle while moving the throttle back and forth until WD40 comes out of the throttle end of the cable.
- Re-install seals on both ends of the cable.
- Re-attach throttle cable to engine.

This will remove the moisture on the cable that is causing freezing.

The bottle w/hose is available from Go-Devil. Call toll free at 888-490-3254 to order.